

Work Order ID 159204

Wednesday, April 05, 2017 2:56:00 PM

159204

Page 1

Item ID: D206-667-147TRN**Accept*****N900040100*****Setup Start*****NS1*****Revision ID:****Stop*****NS2*****Item Name:** Crosstube Assembly, Mid Fwd**Start Date:** 4/24/2017 **Start Qty:** 1.00***1*****Cust Item ID:****Required Date:** 4/28/2017 **Req'd Qty:** 1.00***1*****Customer:****Reference:** SCHEDULED/S**Approvals:****Process Plan:**

DAS

Date: APR 06 2017**Tooling:****Date:****Run Start*****NR1*****QC:**

21

Date:**SPC (Y/N):****Date:****Stop*****NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr**Revision Nbr**

D206-667-147

A

100

1.08

100

Mori Seiki

MORI SEIKI CNC LATHE LARGE

Memo

1.80

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs 206-147 on both ends as per Folio FB029

2-Turn first side as per Folio FB029

3-Blend transition lines only with belt sander 60 grit.

FOLIO REV: 4/1DWG REV: 4

1	Ø	DAS 23 9-89
---	---	-------------------

17/4/11

110

QC2- Inspect parts off machine FAI/FAIB

0.00

110

QC

Memo

0.00

Quality Control

1	Ø	DAS 23 9-89
---	---	-------------------

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐		Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐					
OTHER : ☐									

Work Order ID 159204

Wednesday, April 05, 2017 2:56:00 PM

159204

Page 2

Item ID: D206-667-147TRN**Accept*****N900040100*****Setup Start*****NS1*****Revision ID:****Stop*****NS2*****Item Name:** Crosstube Assembly, Mid Fwd**Start Date:** 4/24/2017 **Start Qty:** 1.00***1*****Cust Item ID:****Required Date:** 4/28/2017 **Req'd Qty:** 1.00***1*****Customer:****Reference:** SCHEDULED/S**Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start*****NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop*****NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

0.00

120

MORI SEIKI CNC LATHE LARGE

1	Ø		DAS 23 9-89
---	---	--	-------------------

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FB029

2-Blend transition lines only with belt sander 60 grit.

3-Remove sand and plugs

FOLIO REV: AADWG REV: A

17/4/12

130

0.00

130

QC2- Inspect parts off machine FAI/FAIB

1	Ø		DAS 23 9-89
---	---	--	-------------------

QC

Memo

0.00

Quality Control

140

0.00

140

QC8- Inspect parts - second check

1	Ø		DAS 47 9-89
---	---	--	-------------------

QC

Memo

0.02

Quality Control

17-04-18

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : ☐			

Work Order ID 159204

Wednesday, April 05, 2017 2:56:00 PM

159204

Page 3

Item ID: D206-667-147TRN**Accept*****N900040100*****Setup Start*****NS1*****Revision ID:****Stop*****NS2*****Item Name:** Crosstube Assembly, Mid Fwd**Start Date:** 4/24/2017 **Start Qty:** 1.00***1*****Cust Item ID:****Required Date:** 4/28/2017 **Req'd Qty:** 1.00***1*****Customer:****Reference:** SCHEDULED/S**Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start*****NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop*****NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
145		0.00							
145									
Crosstubes	Memo	0.27							
Crosstubes	GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.								
150		0.00							
150									
HandFXtube	Memo	2.60							
Hand Finishing Crosstubes	1- PRESSURE WASH X-TUBE INSIDE AND OUT								
	2- ALODINE AND ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE								
160	QC7-Inspect Chemical Conversion Coat	0.00							
160									
QC	Memo	0.02							
Quality Control									

1 0 JW
17-04-24

(X1) 0 20704/25
BER

DAS
37
9-89 17-04-25

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Work Order ID 159204

Wednesday, April 05, 2017 2:56:00 PM

159204

Page 4

Item ID: D206-667-147TRN Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Crosstube Assembly, Mid Fwd
Start Date: 4/24/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 4/28/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference: SCHEDULED/S

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
170	Packaging	0.00							
170									
Packaging	Memo	0.00							
Packaging	LOCATION : LG014								
180	QC21- Final Inspection - Work Order Release	0.00							
180									
QC	Memo	0.10							
Quality Control									

17-04-25

17/4/26

DAS
21
9-89

APR 25 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY			
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong		
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions		
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance		
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect		
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing		
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved		
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing		
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish		
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread		
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence		
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____					
Misidentified ☐	☐ Past Due						

Picklist Print

Wednesday, April 05, 2017 2:56:00 PM

Page 1

Work Order ID: 159204

159204

Parent Item: D206-667-147TRN

D206-667-147TRN

Parent Item Name: Crosstube Assembly, Mid Fwd

Start Date: 4/24/2017

Required Date: 4/28/2017

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP rev:A 11.01.06 new issue DD verf:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6002-115		Manufactured	No			100	Each	70.0000	1	1			

D6002-115

Crosstube Material

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
HALL	60	
107867	60	
LG003	10	
69794	10	

17/4/10

08-0
E2
010

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QS1042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					


DART AEROSPACE LTD	Work Order:	159204
Description: Crosstube Assembly, Mid Fwd	Part Number:	D206-667-147
Inspection Dwg: D206-667-147 Rev: A		Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000	2.245	✓		↑	
	1.984	+0.005/-0.000	1.987	✓			
	2.019	+0.005/-0.000	2.023	✓			
	2.058	+0.005/-0.000	2.061	✓			
	2.097	+0.005/-0.000	2.099	✓			
	2.136	+0.005/-0.000	2.138	✓			
	2.176	+0.005/-0.000	2.176	✓			Vernier
	0.125	+/-0.010	0.125	✓		↓	
	R0.063	+/-0.010	R0.063	✓		RG	
	R2.00	+/-0.010	R2.00	✓		RG	
	R0.063	+/-0.010	R0.063	✓		RG	
	4.438	+/-0.030	4.438	✓		tape	
SIDE B	2.240	+0.005/-0.000	2.243			↑	
	1.984	+0.005/-0.000	1.988				
	2.019	+0.005/-0.000	2.024				
	2.058	+0.005/-0.000	2.063				
	2.097	+0.005/-0.000	2.102				
	2.136	+0.005/-0.000	2.139				
	2.176	+0.005/-0.000	2.178				
	0.125	+/-0.010	0.125	✓		↓	Vernier
	R0.063	+/-0.010	R0.063	✓		RG	
	R2.00	+/-0.010	R2.00	✓		RG	
	R0.063	+/-0.010	R0.063	✓		RG	
	4.438	+/-0.030	4.438			tape	
	99.84	+/-0.020	99.860	✓		tape	

DART AEROSPACE LTD	Work Order: 159204
Description: Crosstube Assembly, Mid Fwd	Part Number: D206-667-147
Inspection Dwg: D206-667-147 Rev: A	Page 2 of 2

WALL THICKNESS MEASUREMENT

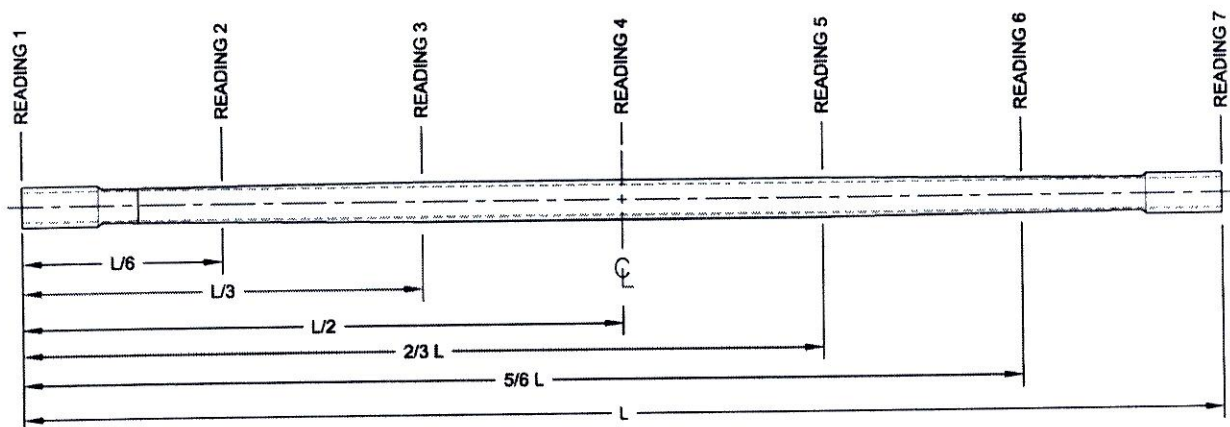

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L = 0"	235	242	229	233	0.013	0.035"
READING 2 L = 16.64	158	144	141	152	0.017	
READING 3 L = 33.28	233	233	231	230	0.003	
READING 4 L = 49.92	238	244	235	233	0.011	
READING 5 L = 66.56	231	237	229	228	0.014	
READING 6 L = 83.2	156	146	137	145	0.019	
READING 7 L = 99.84	241	237	229	231	0.012	

Calibration Result

Actual Block Thickness: 100-200
 SITESCAN 250 Measured Thickness: 100-200

Measured by: DAS 23 9-89 Date: 16/17/12	Audited by: DAS 47 9-89 Date: 17.04.16	Preliminary Approval: Date:
--	---	--

Rev	Date	Change	Revised by	Approved
B	11.06.21	New Issue	KJ	
C	12.06.04	Wall thickness form added	KJ	

Item	Qty -147	Part Number	Description
1	X	D206-667-147	CROSSTUBE ASSEMBLY (206L MID FWD)
2	1	D6002-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2891-1	SUPPORT
6	4	D3595-063-395	RUBBER CUSHION
7	4	MS21920-20	CLAMP (OR MS21920-21)
8	14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
9	AVR	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299- 947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6002-115
FINISHED LENGTH = 99.84±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D206-667-147" AND BATCH NUMBER ON
INSIDE OF CUFF PER DART QSI 044 6.4 (VIBRATING STYLUS).
- 7) WEIGHT: 15.0 lbs (-507 = 12.84)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY,
TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 10 PASSES. MAXIMUM TUBE FLATTENING DUE
TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2891-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI
015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-20 CLAMPS (OR -21) WITH D3595-063-395 RUBBER CUSHIONS TO SECURE
THE D2891-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS
ARE LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 159204 MJS
1704-05

DEO ATTACHED

EW #11-615
11.07.28


UNDER REVIEW


RELEASED
2011-05-23
JN

A	NEW ISSUE	CP	10.11.23
REV.	DESCRIPTION	BY	DATE
DESIGN	92		
DRAWN	91		
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	10.12.23		


DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D206-667-147	REV. A SHEET 1 OF 4
TITLE CROSSTUBE ASSY (206L MID FWD)	SCALE NTS

COPYRIGHT © 2010 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSES OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD

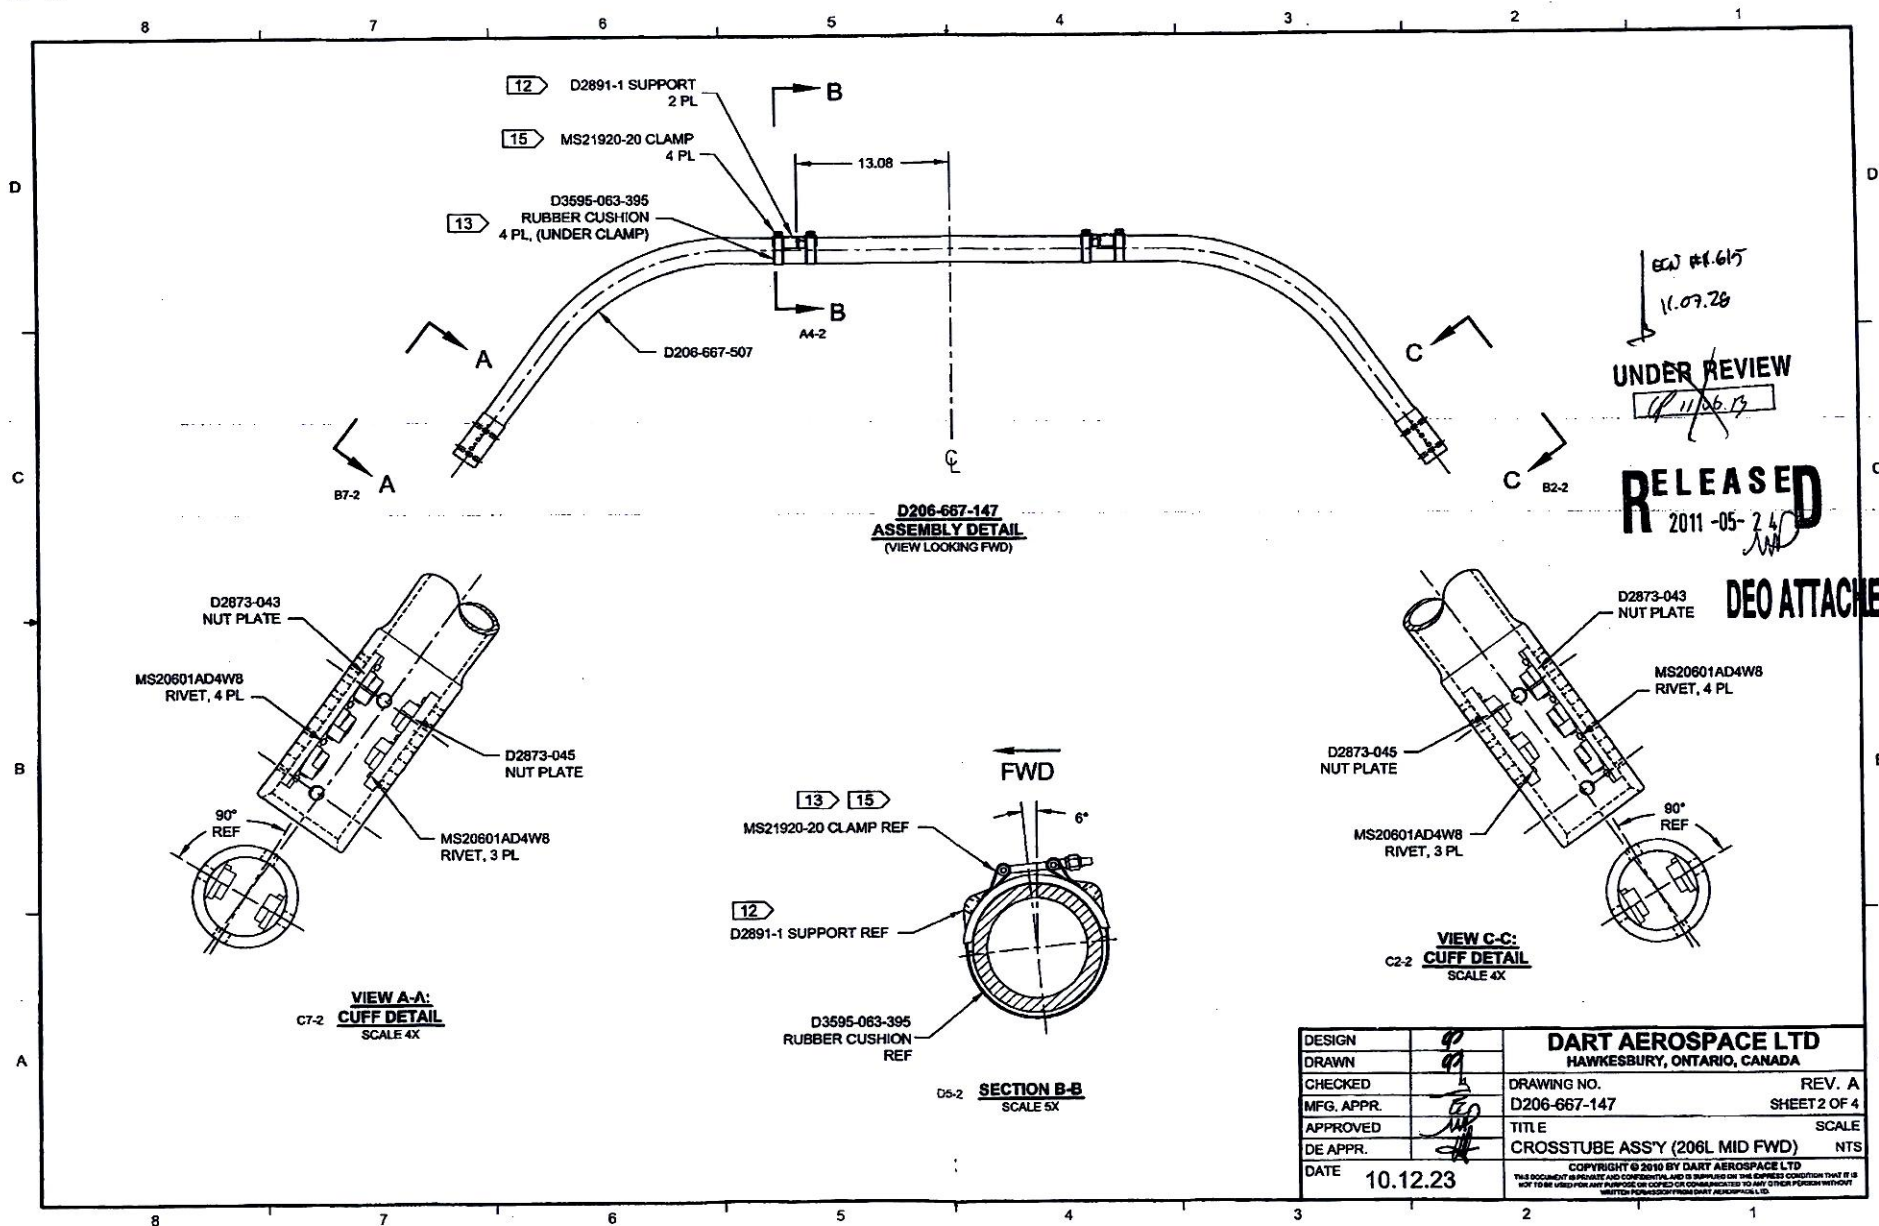

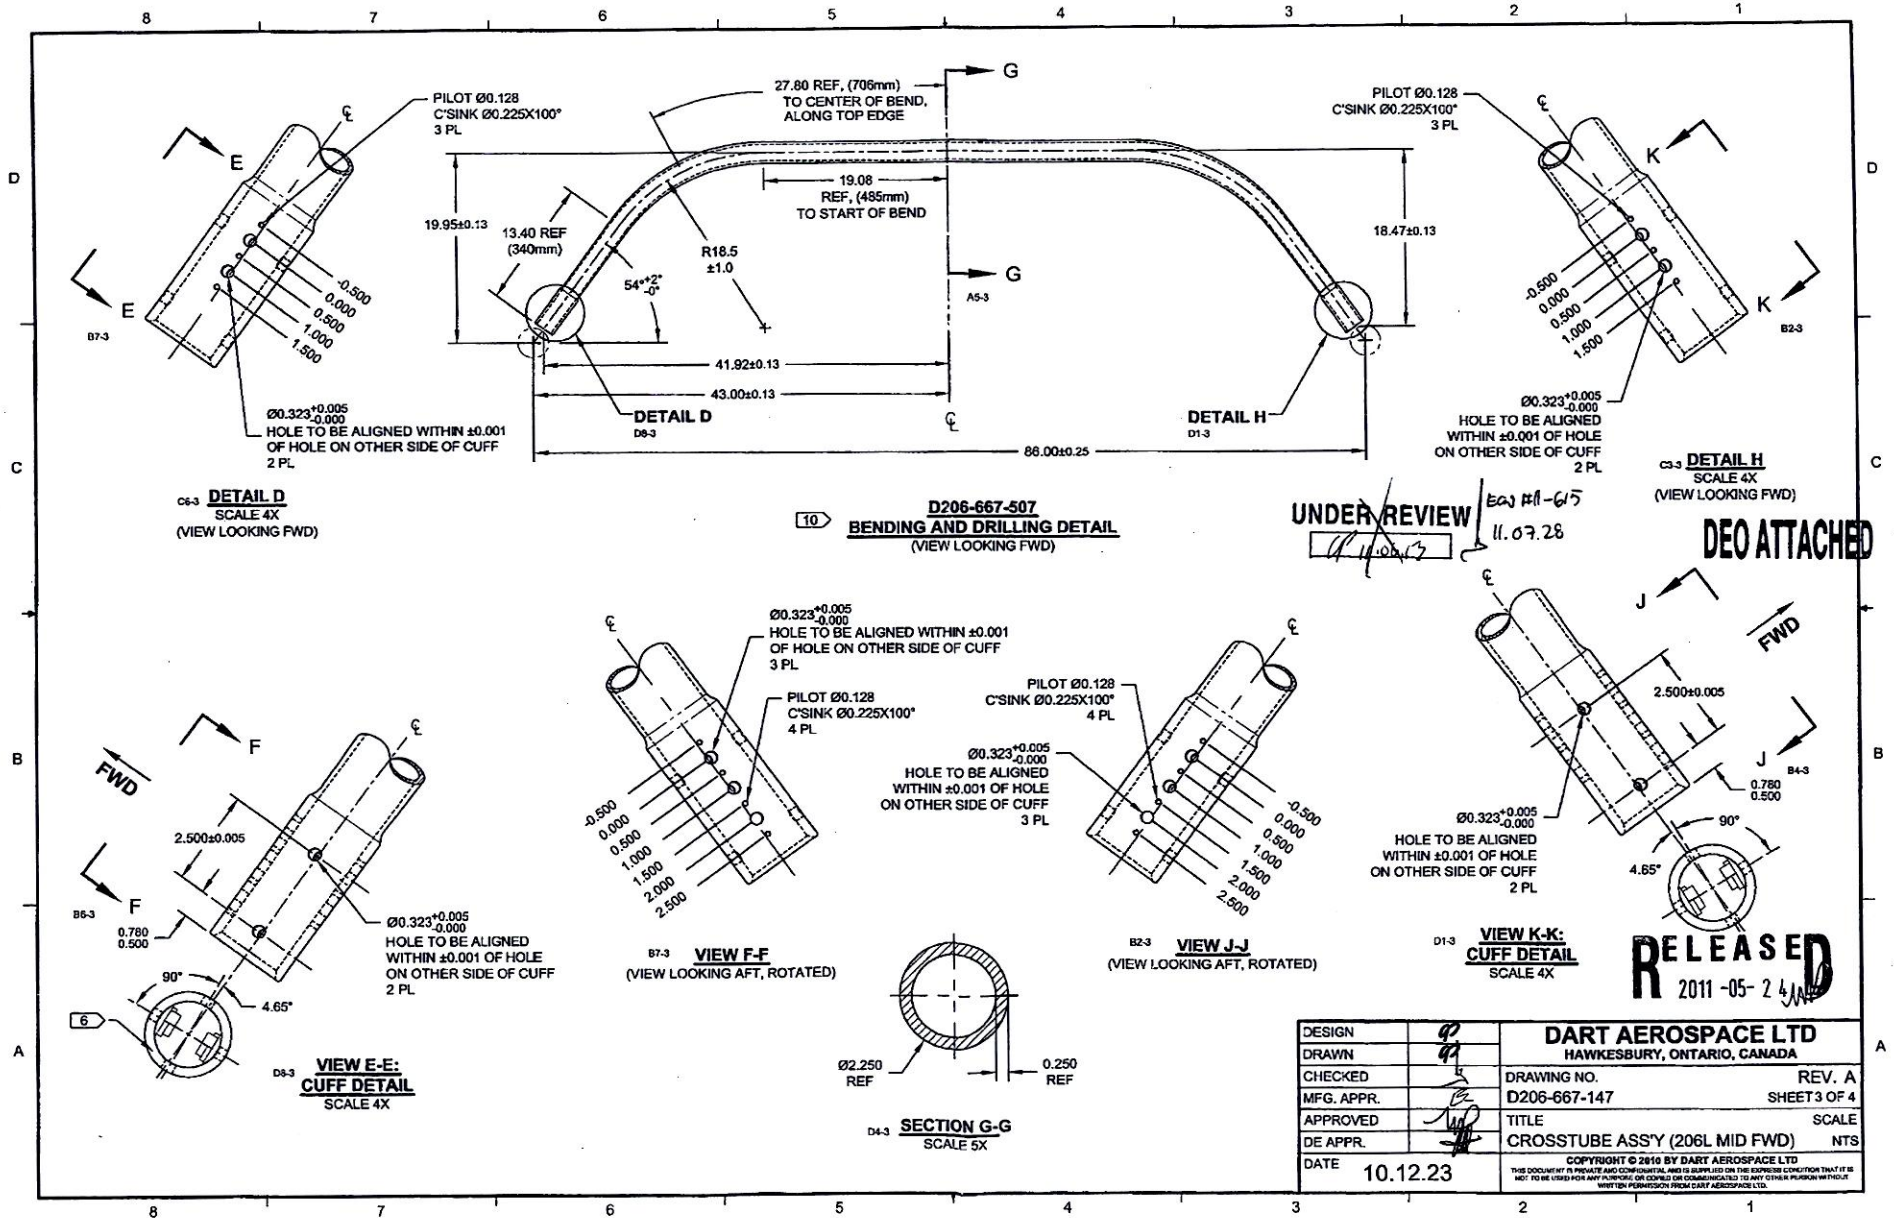

8 7 6 5 4 3 2 1

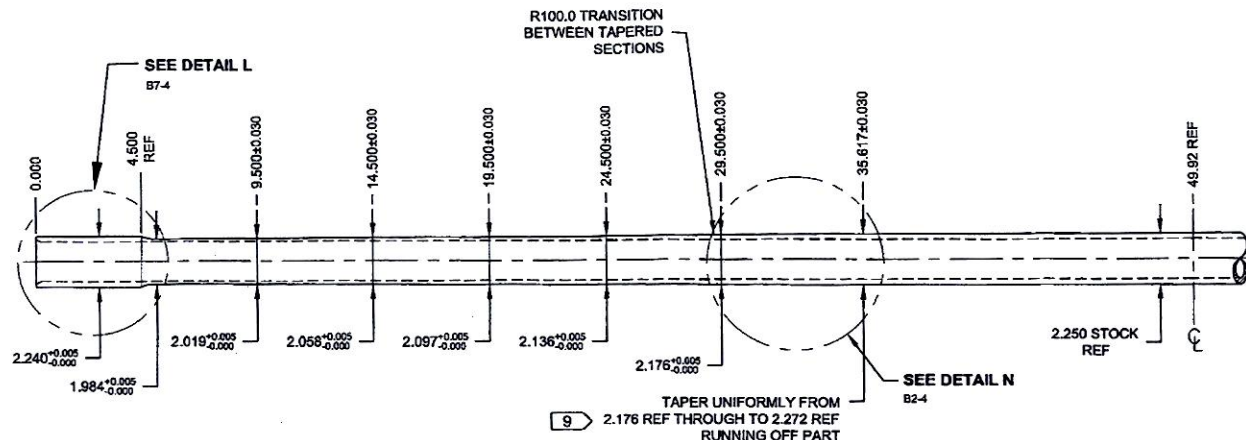


UNDER REVIEW


11.06.13

ECN # 11-615
11.07.20


DEO ATTACHED

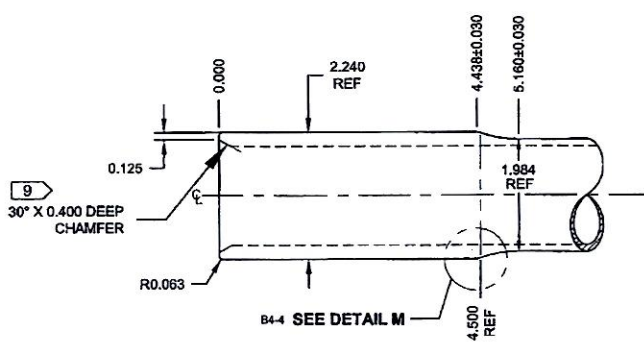

DETAIL L:
D7-4 CROSSTUBE CUFF
NOT TO SCALE

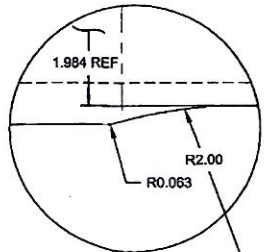

DETAIL M:
A6-4 CUFF TRANSITION
NOT TO SCALE

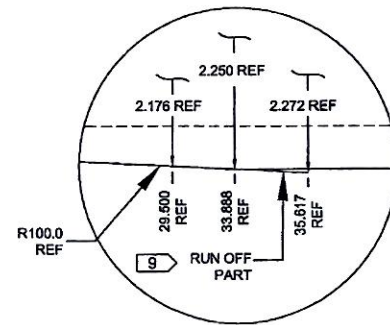

DETAIL N:
C4-4 TAPER RUN-OFF
NOT TO SCALE

RELEASED
2011-05-27

DESIGN	9	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	9	DRAWING NO.	REV. A
CHECKED		D206-667-147	SHEET 4 OF 4
MFG. APPR.		TITLE	SCALE
APPROVED		CROSSTUBE ASSY (206L MID FWD)	NTS
DE APPR.		COPYRIGHT © 2010 BY DART AEROSPACE LTD THIS DOCUMENT IS PROPRIETARY AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	
DATE	10.12.23		

DRAWING NO. D206-667-147	TITLE CROSSTUBE ASS'Y (206L MID FWD)	REV. A	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D206-667-147-A-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>q</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>AS</i>	APPROVED <i>MD</i>		DE APPR. <i>MD</i>		
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11/07/21		DATE 11.07.21		

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:

IS:

Item	Qty -147	Part Number	Description
9	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2891-1 SUPPORT: ABRAD MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2891-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-07-28
MD

DRAWING NO. D206-667-147	TITLE CROSSTUBE ASS'Y (206L MID FWD)	REV. A	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D206-667-147-A-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN AJS	CHECKED	MFG. APPR. <i>E</i>	APPROVED <i>AD</i>	DE APPR. <i>AD</i>		
DATE 12.08.02	DATE 12.08.02	DATE 12.08.02	DATE 12.08.02	DATE 12.08.02	DATE 12.08.02	

PURPOSE:

ADD ELECTRICAL GROUNDING STRAP

CHANGE:

PARTS LIST:

ITEM	QTY -147	PART NUMBER	DESCRIPTION
1	X	D206-667-147	CROSSTUBE ASSEMBLY (206L MID FWD)
10	2	AN742D36	CLAMP
11	2	MS9165-05	ANGLE BRACKET
12	2	MS21042L3	NUT (OR MS21042-3)
13	2	MS27039-1-08	SCREW
14	4	NAS1149C0332R	WASHER (OR AN960C10L)

ADD


GENERAL NOTES:

- 16) MASK AREA UNDER CLAMP PRIOR TO PAINTING
- 17) SEAL EDGES WHERE AN742D36 CLAMP MEETS WITH THE CROSSTUBE USING SIKAFLEX-241/-291 OR MIL-S-8802 CLASS B2 OR PROSEAL 890 SEALANT
- 18) PERFORM RESISTANCE CHECK TO ENSURE MAX RESISTANCE IS 10 MILLIOHMS


ADD

→ AFT

RELEASED
UP 12.08.17
ECN 12-651

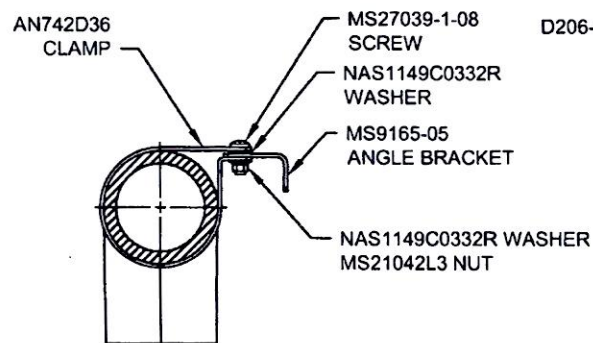

SECTION R-R

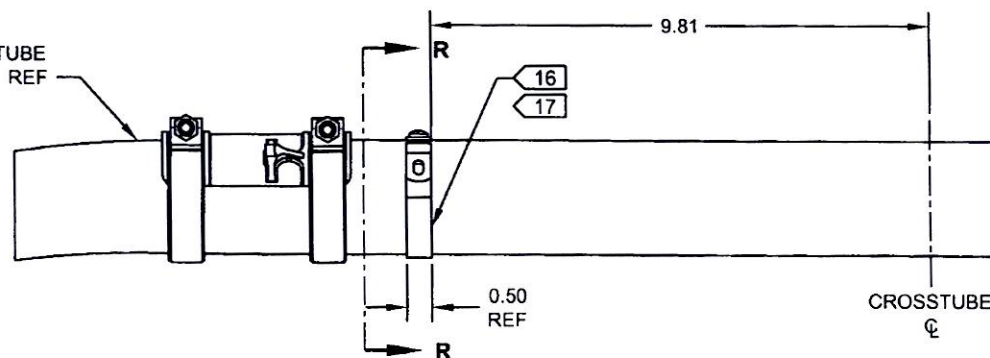

DETAIL P
BONDING STRAP INSTALLATION 2 PL